

Use the same mode for the two timers..

6. Boot Process - Upper 2Kbytes Execution with BLJB = 0

In case of Boot process with BLJB = 0 and BSB = 00, the User Application is executed but the program space located in the upper 2KBytes of the 64KBytes on chip Flash memory cannot be executed. This is due to ENBOOT bit which is set in this Bootloader flow.

Workaround

Clear ENBOOT bit at the beginning of user application software.

7. Flash/EEPROM - First Read after Load Disturbed

In the 'In-Application Programming' mode from the Flash, if the User software application loads the Column Latch Area prior to calling the programming sequence in the UART Bootloader.

The 'Read after load' issue leads to a wrong Opcode Fetch during the column latch load sequence.

Workaround

Update of the Flash API Library. A NOP instruction has to be inserted after the load instruction.

```
MOVX @DPTR,A ;Load Column latches
```

```
NOP ; ADDED INSTRUCTION
```

Active UART Bootloader Errata List

- API program Data Byte - Incorrect Return Value
- API program Data Page - Incorrect Return Value

UART Bootloader Errata History

Version Number	Errata List
0.0 (1.0.0 displayed by FLIP)	1,2

UART Bootloader Errata Description

1. API Program Data Byte - Incorrect Return Value

The PROGRAM DATA BYTE API returns the '0xXX' instead of 0x00 in ACC, but the programmig operation is sucessfully completed.

2. API Program Data Page- Incorrect Return Value

The PROGRAM DATA PAGE API returns the '0xXX' instead of 0x00 in ACC, but the programmig operation is sucessfully completed.



Atmel Corporation

2325 Orchard Parkway
San Jose, CA 95131, USA
Tel: 1(408) 441-0311
Fax: 1(408) 487-2600

Regional Headquarters

Europe

Atmel Sarl
Route des Arsenalux 41
Case Postale 80
CH-1705 Fribourg
Switzerland
Tel: (41) 26-426-5555
Fax: (41) 26-426-5500

Asia

Room 1219
Chinachem Golden Plaza
77 Mody Road Tsimshatsui
East Kowloon
Hong Kong
Tel: (852) 2721-9778
Fax: (852) 2722-1369

Japan

9F, Tonetsu Shinkawa Bldg.
1-24-8 Shinkawa
Chuo-ku, Tokyo 104-0033
Japan
Tel: (81) 3-3523-3551
Fax: (81) 3-3523-7581

Atmel Operations

Memory

2325 Orchard Parkway
San Jose, CA 95131, USA
Tel: 1(408) 441-0311
Fax: 1(408) 436-4314

Microcontrollers

2325 Orchard Parkway
San Jose, CA 95131, USA
Tel: 1(408) 441-0311
Fax: 1(408) 436-4314

La Chantrerie
BP 70602
44306 Nantes Cedex 3, France
Tel: (33) 2-40-18-18-18
Fax: (33) 2-40-18-19-60

ASIC/ASSP/Smart Cards

Zone Industrielle
13106 Rousset Cedex, France
Tel: (33) 4-42-53-60-00
Fax: (33) 4-42-53-60-01

1150 East Cheyenne Mtn. Blvd.
Colorado Springs, CO 80906, USA
Tel: 1(719) 576-3300
Fax: 1(719) 540-1759

Scottish Enterprise Technology Park
Maxwell Building
East Kilbride G75 0QR, Scotland
Tel: (44) 1355-803-000
Fax: (44) 1355-242-743

RF/Automotive

Theresienstrasse 2
Postfach 3535
74025 Heilbronn, Germany
Tel: (49) 71-31-67-0
Fax: (49) 71-31-67-2340

1150 East Cheyenne Mtn. Blvd.
Colorado Springs, CO 80906, USA
Tel: 1(719) 576-3300
Fax: 1(719) 540-1759

Biometrics

Avenue de Rochepleine
BP 123
38521 Saint-Egreve Cedex, France
Tel: (33) 4-76-58-47-50
Fax: (33) 4-76-58-47-60

Literature Requests

www.atmel.com/literature

Disclaimer: The information in this document is provided in connection with Atmel products. No license, express or implied, by estoppel or otherwise, to any intellectual property right is granted by this document or in connection with the sale of Atmel products. **EXCEPT AS SET FORTH IN ATMEL'S TERMS AND CONDITIONS OF SALE LOCATED ON ATMEL'S WEB SITE, ATMEL ASSUMES NO LIABILITY WHATSOEVER AND DISCLAIMS ANY EXPRESS, IMPLIED OR STATUTORY WARRANTY RELATING TO ITS PRODUCTS INCLUDING, BUT NOT LIMITED TO, THE IMPLIED WARRANTY OF MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE, OR NON-INFRINGEMENT. IN NO EVENT SHALL ATMEL BE LIABLE FOR ANY DIRECT, INDIRECT, CONSEQUENTIAL, PUNITIVE, SPECIAL OR INCIDENTAL DAMAGES (INCLUDING, WITHOUT LIMITATION, DAMAGES FOR LOSS OF PROFITS, BUSINESS INTERRUPTION, OR LOSS OF INFORMATION) ARISING OUT OF THE USE OR INABILITY TO USE THIS DOCUMENT, EVEN IF ATMEL HAS BEEN ADVISED OF THE POSSIBILITY OF SUCH DAMAGES.** Atmel makes no representations or warranties with respect to the accuracy or completeness of the contents of this document and reserves the right to make changes to specifications and product descriptions at any time without notice. Atmel does not make any commitment to update the information contained herein. Unless specifically provided otherwise, Atmel products are not suitable for, and shall not be used in, automotive applications. Atmel's products are not intended, authorized, or warranted for use as components in applications intended to support or sustain life.

©2007 Atmel Corporation. All rights reserved. Atmel®, logo and combinations thereof, and Everywhere You Are® are the trademarks or registered trademarks, of Atmel Corporation or its subsidiaries. Other terms and product names may be trademarks of others.

Mouser Electronics

Authorized Distributor

Click to View Pricing, Inventory, Delivery & Lifecycle Information:

Microchip:

[AT89C51ED2-RDRUM](#) [AT89C51ED2-RLRUM](#) [AT89C51ED2-SLRUM](#) [AT89C51ED2-SMRUM](#) [AT89C51RD2-RLRUM](#) [AT89C51RD2-RLTUM](#) [AT89C51ED2-SLSUM](#) [AT89C51ED2-RLTUM](#) [AT89C51ED2-SMSUM](#) [AT89C51ED2-RDTUM](#)